



Copyright 2009

GENERAL INSTALLATION INSTRUCTIONS

Tools/Equipment:


- Measuring Tape To ensure good and "long-term" adhesion (tape or silicone)
- Hacksaw (for basic cutting) - Use Xylene solution to clean window glass (better than Windex)
- Coarse and fine sandpaper - Seal unpainted porous ledge surface with wood/concrete sealant




1. Determine which way to orient the Wedge™

Hints: (To test, use small sample 2" test piece provided)

- If the distance from the glass to edge of casement (A) is 2.75" to 4", we recommend 30° orientation and Wedge™ sides cut "straight"
- If the distance from the glass to edge of casement (A) is 4" or more, we recommend 60° orientation and Wedge™ sides cut "straight"
- If the distance from the glass to edge of casement (A) is less than 2.75", the Wedge™ will extend beyond casement and you need to round off sharp edge on outer sides with sandpaper. Then use touch-up paint

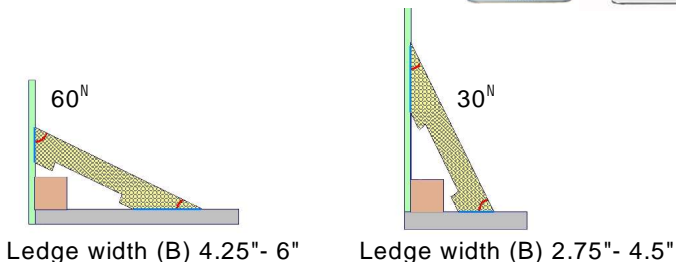

2. Measure the width of the window ledge (C) inside the casement
3. Cut the Wedge™ with hacksaw (or other similar saw with fine tooth count)

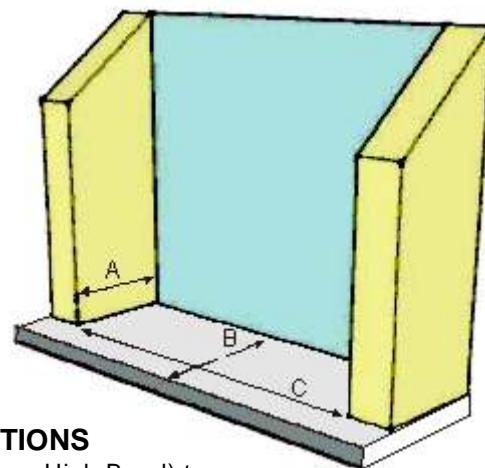

VHB TAPE INSTALLATION INSTRUCTIONS

We offer the Window Wedge™ with and without VHB (Very High Bond) tape.

1. Insert Wedge™ into place and ensure it fits (cut to size as necessary)
2. Clean back of Wedge™ with mineral spirits to get best adhesive bond
3. Cut tape to size
4. Place along both outer long edges on "back" of the Wedge™
5. Peel red protective strip
6. Put into position and press firmly
7. VHB tape reaches maximum strength in 24 hours



SILICONE INSTALLATION INSTRUCTIONS

ADHESIVE: GE "Silicone-I" general purpose CLEAR "rubber sealant" (Part # GE012A)
*** Do not use Silicone II, Liquid Nails, LePage PL, Polyseamseal ***



Tools/Equipment: Caulking Gun (300 ml) + Cleaning Rag + Solvent

1. Insert Wedge™ into place and ensure it fits (cut to size as necessary)
2. Clean back of Wedge™ with mineral spirits to get best bond
3. Place silicone along both outer long edges on "back" of the Wedge™
4. Put into position and press firmly
5. Wipe excess silicone from outer edges to prevent peeling
6. Silicone reaches maximum strength in 24 hours

Silicone Adhesive Safety:
Read safety instructions on tube



136 Walker Street, Atlanta GA 30313
TEL 404-521-9054 ORDER: 800-477-6434 FAX: 404-222-8366
www.PhunZone.com info@PhunZone.com